U.S.

PUBLIC LAND SURVEY MONUMENT RECORD

North


LATITUDE

For Public Land Survey Corners In: WI ADMINISTRAT

WI ADMINISTRATIVE CODE A-E 7.08 REQUIREMENT

T. 2N. R. // E.

CORNER CODE INDEX

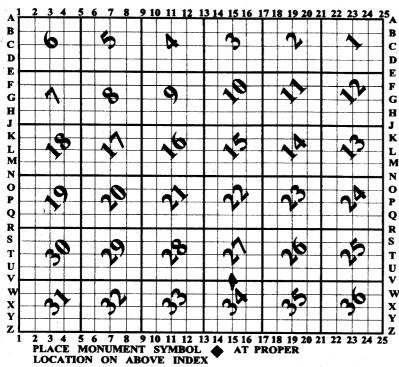

ROCK COUNTY WI

IF AVAILABLE
ROCK COUNTY COORDINATES PERFERRED

Elev.

ELLIPS. HT.

East _____

Hor. Datum _____ Vert. Datum ____

Vert. Datum _____

LONGITUDE ____

GPS (X) ____ TRAVERSE (X) ____

BASED ON THE FOLLOWING CONTROL:

CORNER MONUMENT

O WITNESS MONUMENT

(a)

BEARINGS ARE BASED ON:

OBSERVATION SHEETS 1798 7705

FIELD BOOK _____ PAGE # ____ SHEET _____
SHOW A PLAN VIEW DRAWING DEPICTING THE CORNER MONUMENT AND SURROUNDING PHYSICAL FEATURES, INCLUDING THE EXCAVATION AREA AND DEPTH.
PLANNING & ZONING COMMITTEE ADOPTED THE ABOVE FORM ON 12/2/1982

OF

PL608

- (B) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.
 - 1833 HARRISON EAST ON RAND. BET 27 & 34

2640 TEMPY 1/4 P

5246.34 INT E. BDY 31.68' N OF P LAND ROLLING 1ST RATE WITH GOOD TIMBER W.O. & BLK O. ASPEN, LYNN, HICKY, WALNUT ASH CHERRY & ? OF P. ASH VINES

COR. WEST

2623.17 QUARTER SEC COR (W.O. 24 N5W 13.86' W.O. 16 SBBE 73.92' W.O 24 W.O. 16)

5246.34 INT. W BDY AT P.

- 1837 TWP ROAD RECORDS BK 1 PG 29 COMMENCING 726' WEST OF THE N ¼ COR SEC 34 T2 R11; THENCE RUNNING S4BE 3531' TO A POST THENCE S65E 4620' TO A POST; THENCE S78 ½ E 775.5' TO A POST 825' EAST OF THE S ¼ COR OF SEC 35 ON THE TOWN LINE BETWEEN PLY. AND NEWARK AND THE ABOVE RD IS HEREBY ORDERED TO BE OPENED AND WE THE SUPERVISORS HAVE ALSO TAKE UP AND ALTERED THE TERRITORIAL RD LEADING FROM THE NE COR OF SEC 32 RUNNING EAST ON THE SEC LINE OF 33 AJND 34 TO A PT 726' WEST OF THE N ¼ COR SEC 34 TO THE COMMENCEMENT OF THE ABOVE DESCRIBED RD; THENCE FOLLOWING SAID RD TO THE TOWN LINE OF NEWARK TO A PT WHERE THE ABOVE DESCRIBED RD ENDS AND THE SAID RD IS HEREBY ORDERED TO BE OPENED, 66' IN WIDTH
- 1844 PEASE TWP RD RECORDS BK 1 PG 4 COMMENCING AT THE CORNERS OF SEC 26,27,34 AND 35, IN T2N R11E AND RUNNING WEST ON THE LINE BETWEEN SECTIONS 27 & 34, 2622.84'. SET POST WHERE OLD 1/4 POST ON SAID LINE STOOD BURNT STUMP OF WHITE OAK BEARS N5W 13.86' AND 588E 73.92'; THENCE WEST ON SAID LINE 2622.84' TO THE CORNER OF SEC 27,28,33, & 34, SET POST WHITE OAK 24 INCHES IN DIA BEARS 635E 114.18', BURNT STUMP OF BASS WOOD 24" N7BE B6.46'; THENCE WEST ON LINE BETWEEN SECS 28 AND 33 TO CORNER OF SEC 28,29,32 & 33 5224.5' SETTING POST IN OLD MOUND; THENCE WEST ON LINE BETWEEN SECTIONS 29 & 32, 2652.8' SET POST BY BLACK DAK 24 INCH BEARS N26E 27.06'; THENCE WEST ON THE LINE BEFORE SAID 2642.64' TO THE COR OF SEC 29,30,31 & 32, BLACK OAK BEARS N41E 78? AND N22W 97.02'; THENCE WEST OF LINE BETWEEN SEC 30 & 31, 5297.16' TO THE LINE BETWEEN RANGES 10 & 11 EAST 4 MILES AND 5.94'. SAID RD EXTENDS 33' ON EACH SIDE OF THE ABOVE LINE.
- 1868 LOCKE PG 13 EAST BETWEEN SECS 27 AND 34 VAR 6-18
 2638.68 INTERSECTED 1/4 LINE 21.12' NORTH OF COR.
 FOUND WHERE BTS WERE DUG OUT AND STAKE
 COR IN CENTER OF HIGHWAY AND IN LINE OF
 FENCE FUNNING NORTH VAR CORRECTED 5-50
 CONTINUED EAST WITH VAR 5-20

5288.25 INTERSECTED EAST BOUNDARY 23.43' SOUTH OF COR. VAR CORRECTED 5-50

1873 RUGER VOL 2 PG 114 STONE MON

1874 RUGER VOL 2 P G122 STONE MON. VAR 5-30 726 TO HH IN CENTER OF RD TO THE WEST.

1876 RUGER VOL 2 PG 206 STONE MON. VAR 5-44 2659.14 TO CEN SEC 27, VAR 5-44 5323.23 TO N ¼ COR SEC 27, & 2634.06 TO SW COR SEC 27

1965 BATTERMAN VOL 4 PG 222 FD CUT STONE MON & REF SAME.
NOTE: TIES REMOVED SEE PG 261 VOL 4.

1965 WIDOT PROJECT S11-01(1) STATES NOTHING ABOUT MON.

1966 BATTERMAN VOL 4 PG 261 FD PK 0.13 N. REF. COR

1966 BATTERMAN VOL 4 PG 283 REF. COR. 589-47E TO SE COR SEC 27 & N89-32W TO SW COR SEC 27

SHEET 1 OF 3 CORNER CODE V-15

Donald Barnes 6-17-03 PL608

- 1978 BARNES VOL 5 PG 473 1318.97 TO N/S FENCE TO THE WEST & 2637.95 TO NW COR SEC 34.
- 1981 COMBS CSM 10-285 PIPE IN MON BOX
- 1983 LEUENBERGER MAP #04348 MON. BOX
- 1984 COMBS MAP #13829 FD PIPE IN MON. BOX.
- 1989 COMBS MAP #12293 FD PIPE USED TO SUBDIVIDE SEC 34.
- 1990 COMBS CSM VOL 14 PG 289 ALUM. 2655.08 TO SW COR SEC 27
- 1995 SCHROEDER CSM VOL 18 PG 453 STATES NOTHING ABOUT MON.

FOUND 1" PIPE IN MON. BOX

C) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

ACCEPTED 1" PIPE IN MON. BOX, WHICH PERPETUATED FD CUT L.S.

- D) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (a), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 4 of the witness monuments shown on the drawing in (a), above.
- (E) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning the corner location.
- I, Donald Barnes, hereby certify that the corner location as identified by the corner code index was determined by me under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Denlibanes 6-17-03

SHEET 2 OF 3

CORNER CODE V-15

A.E. 7.08 REQUIREMENT

