
## U.S. PUBLIC LAND SURVEY MONUMENT RECORD

For Public Land Survey Corners in the T. 3N., R. 4E.

CORNER CODE INDEX

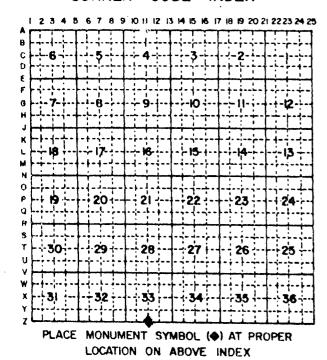

ROCK COUNTY WE

IF AVAILABLE STATE PLANE COORDINATES


North (Y)	Eleve. (Z)
East (X)	Zone
Hor. Datum	Vert. Datum

.c.)

CORNER MONUMENT

O WITNESS MONUMENT

BEARINGS ARE BASED ON: ASSUMED

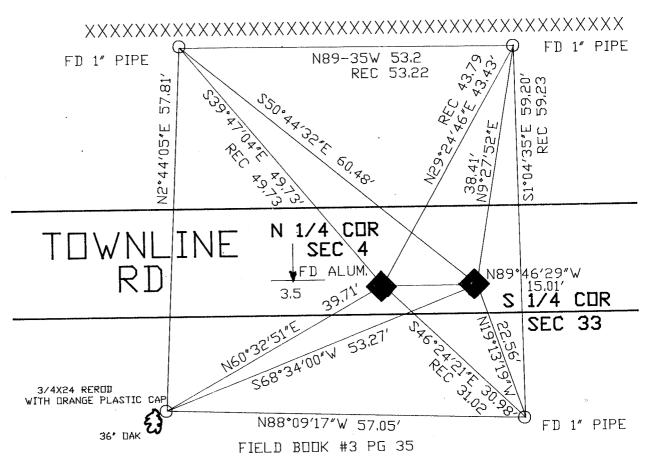

MICROFILMED

SHEET\_\_\_OF\_\_\_

CORNER CODE:


- (B) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.
- 1834 ORIG SET QUARTER SECTION POST. BUR OAK 14 N49W 27.06, BUR OAK 4 N72E 56.1
- 1867 LOCKE VOL 1 PG 288 FOUND STUMP OF BTS AND OLD STAKE. STAKE SURROUNDED BY 4 FLAT LIMESTONES. SHOWS THAT THE N 1/4 CORNER OF SECTION 4 IS WEST 40.92. THIS APPEARS TO BE THE AVERAGE OF THE ORIGINAL GOVERNMENT JOG DISTANCES AT THE SE AND SW CORNERS OF SECTION 33 AND ISN'T IN HARMONY WITH HIS OTHER DISTANCES.
- 1874 RUGER VOL 2 PG 133. FOUND STAKE SURROUNDED BY 4 LIME ALSO FOUND STUMPS OF BTS. SHOWS THE FOLLOWING: 2618.55 VAR 6-48 TO SW CORNER OF SEC 33 2623.50 VAR 6-35 TO SE CORNER OF SEC 33
- $2654.50\ \mathrm{TO}$  CENTER OF SECTION 33. 1965 BATTERMAN JR. VOL 4 PG 214 STATES THAT HE DUG FOUND NOTHING AT THE N 1/4 CORNER OF SECTION 4.
- 1973 LEE VOL 5 PG 3 & 4 SHOWS TIES BUT STATES NOTHING ABOUT THE SHOWS 2610.26 TO SW AND 2610.26 TO SE CORNERS OF SECTION 33 WITH AN EXTERIOR ANGLE OF 179-47-20
- 1973 LEE CSM VOL 3 PG 212. USED THE CORNER FOR THE SURVEY. 1988 BARNES VOL 6 PG 393 SHOWS THE ABOVE RECORD DISTANCES.

## FOUND ALUMINUM MONUMENT AND TIES.

- C) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?
- ACCEPTED THE ALUMINUM MONUMENT AS THE N 1/4 CORNER OF SECTION 4 AND NOT AS THE S 1/4 CORNER OF SECTION 33. I ESTABLISHED THE CORNER ON LINE WITH THE N 1/4 CORNER OF SECTION 4 AND THE SE CORNER OF SECTION 33 AT EQUAL DISTANCE BETWEEN THE SW AND SE CORNERS OF SECTION 33. THIS IS IN HARMONY WITH THE RECORD DISTANCES AND THE STONES THAT I FOUND AT THE SE CORNER OF SECTION 33.
- D) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (a), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 4 of the witness monuments shown on the drawing in (a), above. THERE IS A DISCREPANCY WITH THE CORNER THAT I ESTABLISHED AND THE
- (E) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning the corner location. YES.

ONE THAT LEE ESTABLISHED. THIS IS SHOWN IN THE MAP.

I, Donald Barnes, hereby certify that the corner points as identified by the corner code index were, in a field survey on, September 21,1990, established, re-established, monumented, remonumented, recovered or restored as expressed below and in conformance with the regulations and rules as required in the current manual of survey instructions of the United States

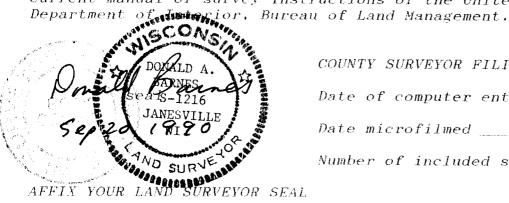

COUNTY SURVEYOR FILING DATA Date of computer entry\_\_\_\_ Date microfilmed Number of included sheets CORNER CODE