
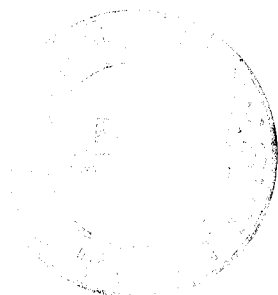


(A) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence of any other material evidence you considered, and whether the monument was found or placed.

- 1868 LOCKE REMONUMENTATION INTERSECTED 1/4 LINE FOR TOWN 3 (CENTER) THREE LKS SOUTH OF CORNER. FOUND LARGE LIMESTONE IN CENTER OF HIGHWAY AND IN LINE OF N AND S FENCES. PLACED N 1/4 CORNER OF T2N 1.32' EAST OF THE S 1/4 CORNER SEC 36. FIELD NOTES SHOW A DISTANCE OF 2662.44 TO THE SW COR AND 2668.38 TO THE SE COR OF SEC 36.
- 1933 SUNNY VOL 3 PG 234 AT THE N 1/4 COR OF SEC 1 T2N HE SET 1" X 36" PIPE IN CONCRETE. PAVEMENT 1.4' NORTH OF CENTER OF CONCRETE PAVEMENT IN LINE WITH S. FENCE. SHOWS THE S 1/4 COR SEC 36 1.32' WEST OF THE N 1/4 COR SEC 1 BUT STATES NOTHING ABOUT THE CORNER.
- 1970 BATTERMAN VOL 4 PG 298 SHOWS A 3/4" PIN AT THE N 1/4 COR OF SEC 1 T2N BUT STATES NOTHING ABOUT THE S 1/4 COR SEC 36.
- 1988 DUG AND FOUND 5'3" DEEP A LIMESTONE 15" X 6" X 2" POINT UP AND 1.26' TO THE EAST A CUT LIMESTONE. PLACED BENT PIPE HORIZONTALLY BY CUT LIMESTONE. DID NOT REMOVE STONE. CORNER IS AT THE CENTER OF THE PAVEMENT. IT APPEARS FROM THE EXCAVATION THAT SUNNY DID NOT DIG FOR THE CORNER. ACCEPTED FOUND LIMESTONE.

(C) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?
ACCEPTED FOUND DOT DISK.

I, Donald Barnes, hereby certify that the corner points as identified by the corner code index were, in a field survey on November 9, 1992, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with the regulations and rules as required in the current manual of survey instructions of the United States Department of Interior, Bureau of Land Management.

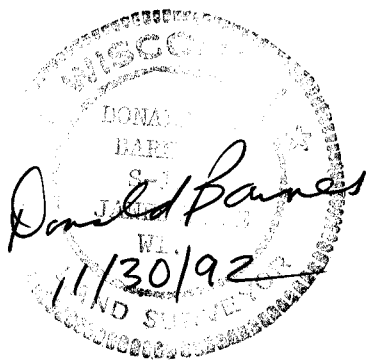

223 (1)

Donald Barnes
 11/30/92

