

Paper weight-110# (minimum)

Black nonfading ink required

U.S. PUBLIC LAND SURVEY MONUMENT RECORD

For Public Land Survey Corners In:

WI ADMINISTRATIVE CODE A-E 7.08 REQUIREMENT

T. 4 N. R. 12 E. 4th P.M.

REV 10/23/2004

USMONREC.DWG

CORNER CODE INDEX

1	2	3	4	5	6	7	8	9	10	11	12	13	14	15	16	17	18	19	20	21	22	23	24	25	
A																									A
B																									B
C	6																								C
D																									D
E																									E
F																									F
G	7																								G
H																									H
J																									J
K																									K
L	18																								L
M																									M
N																									N
O																									O
P	19																								P
Q																									Q
R																									R
S																									S
T																									T
U	30																								U
V																									V
W																									W
X	31																								X
Y																									Y
Z																									Z

12 FULTON TWP
ROCK COUNTY WI

IF AVAILABLE
ROCK COUNTY COORDINATES PREFERRED

North _____ Elev. _____

East _____

Hor. Datum _____ Vert. Datum _____

LATITUDE _____ ELLIPS. HT. _____

LONGITUDE _____

NAD83(91) _____ NETWORK ADJ. YR _____

GPS (X) _____ TRAVERSE (X) _____

BASED ON THE FOLLOWING CONTROL:

PLACE MONUMENT SYMBOL **◆** AT PROPER LOCATION ON ABOVE INDEX

◆ CORNER MONUMENT

○ WITNESS MONUMENT

BEARINGS ARE BASED ON: _____

FIELD BOOK _____ PAGE # _____

SHEET 1 OF 3

SHOW A PLAN VIEW DRAWING DEPICTING THE CORNER MONUMENT AND SURROUNDING PHYSICAL FEATURES, INCLUDING THE EXCAVATION AREA AND DEPTH.

PLANNING & ZONING COMMITTEE ADOPTED THIS FORM ON 12/2/1982

CORNER CODE R-9(1)

FU585 ^

(B) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

- 1836 (AUG2) BURNHAM EAST RANDOM BETW SEC 20 & 29
429? EAST RANDOM BETW SEC 20 & 29 T4N R12E
1155 ENTER DRY PRAIRIE
5280 INT EAST BOUNDY 64.02' SOUTH
WEST CORRECTION BETWN 29 & 20
BUR OAK 8 IN DIA
2640 SET 1/4 SEC POST YELLOW OAK 24 N86E 3.3'
W. OAK 24 S63 1/2W 35.64'
NO STATION
5280 TO CORNERS
- 1834 HARRISON NORTH BETWEEN SECS 20 & 21 PG 20
4884 LEAVE ROCK RIVER & SET MEANDER POST ON RIGHT
BANK OF SAME {W OAK 12 N7E 63.36' WHITE OAK
18 N33W 49.5'
5280 SET COR TO SECS 16,17,20,&21 RED OAK 18 S41E
7.92' RED OAK 12 S29W 14.52' WHITE OAK 20
N58W 47.52' WHITE OAK 12 N37E 33' LAND
ROLLING 2ND RATE TIMBER MOSTLY WHITE OAK.
GRASS & WEEDS.
- 1836 (AUG) BURNHAM EAST RANDOM BETWN SECS 21 & 28
4620 LEAVE PRAIRIE
5241.06 INT EAST BOUNDY AT STAKE FIRST RATE DRY
PRAIRIE & BUR OAK OPENINGS
WEST CORRECTED BETWN SECS 28 & 21
2620.2 SET 1/4 SEC POST BUR OAK 18 S61 1/2E 36.96' NO
OTHER BEARING
NO STATIONS
5241.06 TO CORNERS
- 1836 (AUG) BURNHAM NORTH BETWEEN SECTIONS 28 & 29
384.12 BUR OAK 12 IN DI
2640 SET 1/4 SEC POST YELLOW OAK 18 N72 1/2W 934.56'
W. OAK 16 S50 1/2W 466.62 FIRST RATE W YELLOW &
BUR OAK OPENINGS & DRY PRAIRIE
3300 ENTER DRY PRAIRIE
5280 SET POST COR TO 20,21,28 & 29 BUR OAK 16 N8
1/2E 934.56' BUR OAK 8 N50 1/2W 466.62'
FIRST RATE W., YELLOW, BUR OAK OPENINGS & DRY
PRAIRIE
- 1843 TWP RD BK 1 PG 2 SURVEYED ON THIS INSTANT A PIECE OF
RD BEGINNING AT AN ANGLE POST IN A RD (A PART OF WHICH
HAS BEEN DISCONTINUED) THE SAID POST STANDS IN THE
LINE BETWEEN SEC 20 & 29, THENCE N81-30E BOUNDING THE
SAID LINES 1314.06' TO THE [SE COR SEC 20] CORNER OF
SEC 20 & 21, 28 & 29, THENCE ON THE LINE BETWEEN
SECTION 21 & 28 N81-30E 3923.7 TO AN ANGLE POST.
THENCE S63E 4488'; THENCE N84E 3267' TO THE QUARTER
STAKE BETWEEN SEC. 26 & 27; THENCE ON THE LINES
PASSING THROUGH THE CENTER OF 26 N82-15E 1402.5' TO
THE BUR OAK TREE; THENCE N76E 554.4' TO A WHITE OAK,
N17-45E 561' TO ANGLE POST, THENCE N47-45E 473.88';
THENCE N66-30E 864.6' INTERSECTING THE ABOVE
MENTIONED ROAD 1969.44' S76W OF THE ROAD LEADING
FROM JANESVILLE TO LAKE KOSHANONG.
- 1843 TWP RD BK 1 PG 16 BEGINNING AT AN ANGLE POST STANDING
ON A LINE BETWEEN SEC 20 & 29, THENCE N81-30E
BOUNDING THE SAID LINES 1314.06' TO THE [SE COR SEC
20] CORNER OF SEC 20 & 21, 28 & 29, THENCE ON THE LINE
BETWEEN SECTION 21 & 28 N81-30E 3923.7 TO AN ANGLE
POST. THENCE S63E 4488'; THENCE N84E 3267' TO THE
QUARTER STAKE BETWEEN SEC. 26 & 27; THENCE ON THE
LINES PASSING THROUGH THE CENTER OF 26 N82-15E
1402.5' TO THE BUR OAK TREE; THENCE N76E 554.4' TO A

SHEET 1 OF 3

CORNER R-9(1)

Donald
Bane 11/14/07

FU585

- WHITE OAK, N17-45E 561' TO ANGLE POST, THENCE N47-45E 473.88'; THENCE N66-30E 864.6' INTERSECTING THE ABOVE MENTIONED ROAD 1969.44' S76W OF THE ROAD LEADING FROM JANESVILLE TO LAKE KOSHANONG. [COX RD]
- 1974 LEE VOL 5 PG 12 FD NOTHING. SET MON & REF SAME BY PRORATION FROM SOUTH. FB #170 PAGES 83, 117, & 118 FIELD BOOK CALLS FOR PLACEMENT OF AN ALUM. MON. CALLS FOR THE S 1/4 COR AS MIDWAY BETWEEN THE SE & SW CORNERS OF SEC 21. MY DISTANCES AND OTHERS SHOW THIS IS NOT THE CASE.
- 1976 BARNES VOL 5 PG 97 FD MON. 2641.12 TO S 1/4 COR SEC 21, 2631.83 TO W 1/4 COR SEC 21
- 1982 BARNES VOL 6 PG 258 FD ALUM. MON. TIED INTO AERO-METRIC AIR PHOTO CONTROL. ELEV 853 288,849.18; 2,243,703.27
- 1985 COMBS #8012 FD ALUM. MON, 1320.62 WEST OF A SET R/R SPIKE @ THE INT. OF THE CENTER OF PVMT.
- 1987 NORTHROP CSM VOL 13 PG 54 FD CI. N89-40-11E N 1/4 COR SEC 28 TO NE COR SEC 28 & S89-46-44W TO N 1/4 COR SEC 28 TO NW COR SEC 28
- 1993 SCHROEDER CSM VOL 16 PG 391 STATES NOTHING ABOUT MON. NE COR OF CSM IS WEST 349.20'
- 2001 MICHAEL P-9 FD ALUM CAPPED MONUMENT SEE V5 PG 97 NO-07-23E (NAD83(91) 2631.83 TO E 1/4 COR SEC 20
- 2001 MICHAEL R-9 288,856.41; 2,212,165.89 NAD83(91). FD ALUM. CAPPED MON. 5.5' NORTH OF SOUTH PVMT EDGE. REFERENCED COR. LEE'S REFERENCE MONUMENTS WERE REMOVED OR DISTURBED BY FARMING.
- 2005 COMBS CSM VOL 28 PG 280 FD ALUM. 2650.40 TO ALUM @ N 1/4 COR SEC 29

FD ALUM. MON.

C) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

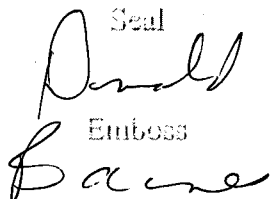
ACCEPTED FD MON.

D) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (a), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 4 of the witness monuments shown on the drawing in (a), above.

NONE

(E) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning the corner location.

I, **Donald Barnes**, hereby certify that the corner location as identified by the corner code index was determined by me under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Seal

Emboss

SHEET 2 OF 3

11/14/07

CORNER CODE

R-9(1)

A.E. 7.08 REQUIREMENT

EMBOSSED SEAM
Daniel Barnes
 11/14/07

R-9(1)
 SHEET 3 OF 3

