

Paper weight-110# (minimum)

Black nonfading ink required

U.S. PUBLIC LAND SURVEY MONUMENT RECORD

For Public Land Survey Corners In:

WI ADMINISTRATIVE CODE A-E 7.08 REQUIREMENT

T. 4 N. R. 12 E. 4th P.M.

REV 10/23/2004

USMONREC.DWG

CORNER CODE INDEX

A	1	2	3	4	5	6	7	8	9	10	11	12	13	14	15	16	17	18	19	20	21	22	23	24	25	A
B																										B
C																										C
D																										D
E																										E
F																										F
G																										G
H																										H
J																										J
K																										K
L																										L
M																										M
N																										N
O																										O
P																										P
Q																										Q
R																										R
S																										S
T																										T
U																										U
V																										V
W																										W
X																										X
Y																										Y
Z																										Z

FULTON TWP
ROCK COUNTY WI

IF AVAILABLE
ROCK COUNTY COORDINATES PREFERRED

North _____ Elev. _____

East _____

Hor. Datum _____ Vert. Datum _____

LATITUDE _____ ELLIPS. HT. _____

LONGITUDE _____

NAD83(91) _____ NETWORK ADJ. YR _____

GPS (X) _____ TRAVERSE (X) _____

BASED ON THE FOLLOWING CONTROL:

PLACE MONUMENT SYMBOL AT PROPER LOCATION ON ABOVE INDEX

CORNER MONUMENT

WITNESS MONUMENT

(a)

BEARINGS ARE BASED ON: _____

FIELD BOOK _____ PAGE # _____

SHEET 1 OF 2

SHOW A PLAN VIEW DRAWING DEPICTING THE CORNER MONUMENT AND SURROUNDING PHYSICAL FEATURES, INCLUDING THE EXCAVATION AREA AND DEPTH.

PLANNING & ZONING COMMITTEE ADOPTED THIS FORM ON 12/2/1982

CORNER CODE C-17(1)

FU518^

(B) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

- 1834 (MAR/APR) HARRISON NORTH BET SECS 2 & 3
1174.80 WO 12 IN DIAM.
2447.28 W.O. 12 IN DIAM.
2640 QUARTER SEC COR. {W.O. 12 N88W 33' W.O. 12
S21E 67.98' W.O. 12 W.O. 12} MARKED
4116.42 W.O. 12 IN DIAM
5032.5 TRAIL & ROAD N.E.
5346 INT. N. BDG. 21.12' E OF POST {BURR O 12 S35W
40.92' BURR O 12 S19E 26.4' LAND ROLLING 2ND
RATE TIMBER BURR & WHITE OAK. UNDERG. ? GRASS
& WEEDS
- 1881 LEE VOL 2 PG 324 FD STUMPS OF B.T.S & FENCE POST AT
COR
- 1893 TOWNS BK 5 PG 48 "PARK PLACE ADD. TO EDGERTON" USED
COR BUT STATES NOTHING ABOUT MON.
- 1960 ELY BK 20 PG 34 "NORTH LAWN" USED COR BUT STATES
NOTHING ABOUT MON.
- 1962 ELY BK 21 PG 35 "FIRST ADD TO NORTH LAWN" STATES
NOTHING ABOUT MON.
- 1968 WEIR BK 24 PG 11 "2ND ADD. TO NORTH LAWN" USED COR BUT
STATES NOTHING ABOUT MON.
- 1972 WEIR 2089 DL 48 SHOWS AT FENCE INT. BUT STATES
NOTHING ABOUT IT. ANGLE 88-25-50 @ E 1/4 COR SEC 3 FROM
WEST TO NORTH.
- 1974 LEE BK 26 PG 31 "NORTH LAWN 3RD ADD" STATES NOTHING
ABOUT MON.
- 1974 COMBS #12974 & 12973 "SHANNON'S ADD. TO EDGERTON"
FD PIPE, 2587.92 TO CEN SEC 3 & ANGLE 91-49-50 @ E 1/4
COR SEC 3 FROM SE COR SEC 3 TO CEN SEC 3.
- 1975 NORTHROP #1006 FD 2" PIPE AT FENCE COR.
- 1975 NORTHROP #13220, 8836, 13219, & 13218 SUB. 2" PIPE
2633.12 TO SE COR SEC 3, 2588.27 TO CEN SEC 3 WHICH IS
IN A 30" CHERRY TREE & ANGLE 91-52-00 @ E 1/4 COR SEC 3
FROM SE COR SEC 3 TO CENTER SEC 3.
- 1978 SANDSNES #1015, 994, 997 & 1013 AIR PHOTO GROUND
CONTROL.
- 1978 SANDSNES VOL 5 PG 447 PROVIDED THE FOLLOWING DATA:
307,619.49; 2,254,090.78
- 1980 NORTHROP CSM VOL 10 PG 132 2" IP. DL 48 ASSESSOR'S
PLAT OF EDGERTON.
- 1984 BARNES VOL 6 PG 326 307,616.49; 2,254,090.78 N1-42-32W
2727.06 TO NE COR SEC 3, S1-56-38E 2633.11 TO SE COR
SEC 3, N89-57-42W 2588.25 TO CEN SEC 3, 5172.11 TO W 1/4
COR SEC 3
- 1986 COMBS #12974 & 12973 SHANNON'S ADD. TO EDGERTON FD
PIPE, ANGLE 91-49-50 @ E 1/4 COR SEC 3 FROM SE COR SEC 3
TO CEN SEC 3, 2587.92 TO CEN SEC 3.
- 1986 NORTHROP BK 32 PG 30 "DOVE DALF" 2" PIPE 2633.26 TO SE
COR SEC 3 & ANGLE 91-50-36 @ E 1/4 COR SEC 32 FROM SE
COR SEC 3 TO E/W 1/4 LINE
- 1987 RADL C -17 I FOUND THE 2 INCH IRON PIPE AS PERPETUATED
BY PREVIOUS SURVEYS. THE IRON PIPE IS TIPPED EAST 0.2'.
REFERENCED SAME. SHOWS AT FENCE INT. & NEAR
SOUTHEASTERLY TRAIL. 307,619.325 N/S; 254,090.72
E/W
- 1987 RADL CSM VOL 13 PG 148 IRON STAKE 2727.32 TO NE COR
SEC 3. 307,619.325; 254,090.724
- 1990 NORTHROP #11905, 11906, 2480, & 2481 2633.23 TO NE COR
SEC 10, ANGLE 91-08-49 @ NE COR SEC 10 FROM E 1/4 COR
SEC 3 TO N 1/4 COR SEC 11

PAGE 1 OF 2

FILE CORNER CODE C-17(1)

Donald Baeres
11/01/07

FU518

1991 NORTHROP CSM VOL 15 PG 23 2" PIPE 2633.20 TO SE COR SEC 3, 1922.33 TO CONC. MON ON THE E/W 1/4 OF SEC 3, ANGLE 91-50-36 FROM SE COR SEC 3 TO CONC. MON.

1994 SCHROEDER CSM VOL 17 PG 316 USED COR BUT STATES NOTHING ABOUT MON. ANGLE 89-34-25 @ E 1/4 COR SEC 2 FROM SE COR SEC 2 TO W 1/4 COR SEC 2.

1995 COMBS BK 32 PG 287 "COUNTY OAKS" FD 2" PIPE. 2632.83 TO SE COR SEC 3, 293.85 TO PIPE ON E/W 1/4 LINE SEC 3, ANGLE 91-49-20 @ E 1/4 COR SEC 3 FROM SE SEC 3 TO PIPE ON E/W 1/4 SEC 3, ANGLE 88-41-05 @ E 1/4 COR SEC 3 FROM E/W 1/4 LINE SEC 2 TO SE COR SEC 3, 1305.81 TO N 1/16TH COR OF SW 1/4 SEC 2.

1997 NORTHROP #8449&8446 2" ID PIPE

1997 NORTHROP #8447 & 8450 2" PIPE

1997 NORTHROP #6682 FD 2" PIPE 2727.72 TO NE COR SEC 3.

FD 2" IRON PIPE & 4 REFERENCE PIPES AS SET BY RADL IN 1987 (C-17). SET CARSONITE POST NEAR PIPE.

C) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

ACCEPTED FD PIPE. IS WITHIN 6' OF A STRAIGHT LINE BETWEEN THE NE & SE CORNERS OF SEC 3.

D) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (a), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 4 of the witness monuments shown on the drawing in (a), above.

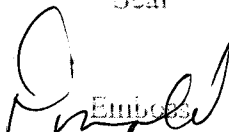
WAS NOT ABLE TO DETERMINE WHO PLACED THE PIPE. APPEARS TO BE IN HARMONY WITH RECORD DISTANCES. DOES NOT APPEAR TO DISPUTE ANY OTHER LOCATION.

(E) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning the corner location.

NO

I, **Donald Barnes**, hereby certify that the corner location as identified by the corner code index was determined by me under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Seal


Barnes
11/01/07

SHEET 2 OF 2

CORNER CODE

A.E. 7.08 REQUIREMENT

C-17(1)