

Paper weight-110# (minimum)

Black nonfading ink required

U.S. PUBLIC LAND SURVEY MONUMENT RECORD

For Public Land Survey Corners In:

WI ADMINISTRATIVE CODE A-E 7.08 REQUIREMENT

T. AN. R. 12E. 4th P.M.

REV 10/23/2004

USMONREC.DWG

CORNER CODE INDEX

1	2	3	4	5	6	7	8	9	10	11	12	13	14	15	16	17	18	19	20	21	22	23	24	25	
A																									A
B	6					5					4				3					2				1	B
C																									C
D																									D
E																									E
F																									F
G	7					8					9				10					11				12	G
H																									H
J																									J
K																									K
L	18					17					16				15					14				13	L
M																									M
N																									N
O																									O
P	19					20					21				22					23				24	P
Q																									Q
R																									R
S																									S
T	30					29					28				27					26				25	T
U																									U
V																									V
W																									W
X	31					32					33				34					35				36	X
Y																									Y
Z																									Z

FULTON TWP

ROCK COUNTY WI

IF AVAILABLE
ROCK COUNTY COORDINATES PREFERRED

North _____ Elev. _____

East _____

Hor. Datum _____ Vert. Datum _____

LATITUDE _____ ELLIPS. HT. _____

LONGITUDE _____

NAD83(91) _____ NETWORK ADJ. YR _____

GPS (X) _____ TRAVERSE (X) _____

BASED ON THE FOLLOWING CONTROL:

PLACE MONUMENT SYMBOL AT PROPER LOCATION ON ABOVE INDEX

CORNER MONUMENT

WITNESS MONUMENT

BEARINGS ARE BASED ON: (a) _____

FIELD BOOK _____ PAGE # _____

SHEET 1 OF 2

SHOW A PLAN VIEW DRAWING DEPICTING THE CORNER MONUMENT AND SURROUNDING PHYSICAL FEATURES, INCLUDING THE EXCAVATION AREA AND DEPTH.

PLANNING & ZONING COMMITTEE ADOPTED THIS FORM ON 12/2/1982

CORNER CODE J-9

FU545 ^

(B) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

- 1834 (MAR/APR) HARRISON EAST ON RANDOM BET. SECS 8 & 17
2640 TEMPY 1/4 POST
3228.06 WAGON ROAD NE
4113.12 TRAIL NE
4488 LEAVE PRAIRIE & ENTER TIMBER
5323.56 INT. E BDY 18 N OF P LAND GENTLY ROLLING 1ST
RATE PRAIRIE COVERED WITH WILD GRASS & WEEDS
COR WEST BET SEC 8 & 17
2661.78 QUARTER SEC COR {SET POST & RAISED MOUND OF
EARTH & SODS
5323.56 INT SEC COR
- 1834 (MAR/APR) HARRISON EAST ON RAND BET SECS 9 & 16
2640 TEMPY 1/4 SEC COR
5305.08 INT. E BDY 26.4' N OF P LAND & ? SAME
COR WEST
2652.54 QUARTER SEC COR {W.O. 12 S52E 3.96' W.O. 10
N65W 5.28' W.O. 12 W.O 10} MARKED
5305.08 INT. SEC COR
- 1834 (MAR/APR) HARRISON ORIG GOV. SURVEYOR
NORTH BETWEEN SECS 8 & 9
792 ROAD EAST & ENTER MARSH
1848 LEFT MARSH
2640 QUARTER SEC COR. WHITE OAK 20 N59W 42 &
WHITE OAK 12 S83E 151
5280 COR TO SECS 4,5,8,9 WHITE OAK 14 S76E 286, RED
OAK 8 N36E 210, BURR OAK 20 N38W 118, & WHITE
OAK 24 S53W 153.
- 1834 (APR/MAR) HARRISON NORTH BETWEEN SECS 16 & 17 PG 21
1386 TRAIL N.E.
2640 QUARTER SEC. COR. {RED O. 10 S69E 16.5'
RED O 12 N74W 68.64'
3851.76 WD 20 IN DIAM
4720.98 RED O 12 IN DIAM
5280 COR TO SECS 8,9,16,17 {BURR O 24 S30W 93.26'
RED OAK 12 N80E 64.02' BURR O 12 N24W
144.54' & BURR O 10 S10E 81.84' LAND LEVEL 2ND
RATE TIMBER RED BURR & WHITE GRASS & WEEDS
- 1845 STEBBINS TWP RD BK 1 PG 6 BEGINNING AT THE NORTH
EAST COR OF SEC 17 T4N R12E ; THENCE SOUTH ON THE
SECTION LINE 1977.36' TO A POINT ON SAID LINE
662.64' NORTH OF 1/4 POST. THE LENGTH OF SAID RD IS
1977.36'. COURSE GIVEN ACCORDING TO THE TRUE
MERIDIAN. [GTH F]
- 1885 STEBBINS BK 1 PG 6 TWP RD BEGINNING AT A STAKE ON
THE NORTH LINE OF SEC 3 T4NR12E 1365.54' WEST OF THE
NE COR OF SAID SEC; THENCE S30W 2640 SET ANGLE POST,
THENCE S25W 3478.2 SET ANGLE POST, BURR OAK, N45W
726'; THENCE S70W 2681.58' SET ANGLE POST BURR OAK 8;
N50E 4620; THENCE S50-30W 2520.54 SET ANGLE POST W.
OAK 20 S37E 86.46' BLACK OAK 24 S61E 103.62'; THENCE
S. 2118.6' TO LINE BETWEEN 9 & 16 1320 E OF SW COR OF 9;
THENCE WEST ON SEC LINE 11,880' TO THE SW COR OF SEC
7 & THE WHOLE LENGTH OF THE RD IS 25,318.92'. COURSE
GIVEN ACCORDING TO THE TRUE MERIDIAN. VARIATION OF
NEEDLE 7-30 [GTH F & STH 51]
- 1871 RUGER VOL 2 PG 57, VOL 5 PG 431, & #1079 FD STUMP
OF SOUTH WEST BEARING & TREE & WHERE STUMP OF SOUTH
EAST BEARING TREE HAD BEEN DUG UP. SET HH12X7X5 &
SURROUNDED IT WITH 3 HH STONES VAR 8-02 2673.82 TO S
1/4 COR SEC 8. S 1/4 COR LOST & SET MIDWAY ON LINE WITH
SE & SW CORNERS OF SEC 8. RUGER FIELD BK R-K PG 144
- 1872 LEE VOL 2 PG 89 FD STONE AT COR 2684.22 TO S 1/4
COR SEC 9. 1798.5 WEST OF RD (? CENTER OR WEST R/W
LINE)
SHEET 1 OF 2
CORNER CODE J-9

Donald Barnes
11/04/07

FU545

- 1875 RUGER VOL 2 PG 199 FD LIMESTONE AT COR. ALSO FD STUMP OF SW BT & WHERE STUMP OF NE BT HAD BEEN DUG UP. VAR 7-53 2674.32 TO N ¼ COR SEC 16, VAR 6-31 2654.52 TO W ¼ COR SEC 16.
- 1898 BROWN VOL 2 PG 506 & 1078 COR STONE GONE DROVE IRON BY RUGERS NOTES. 2666.73 TO S ¼ COR SEC 8
- 1937 SUNNY VOL 3 PG 359 FD BOTTOM 6" OF ORIGINAL 2 ½" FOUND OAK STAKE. SET 1 ½"X18" GAPPED PIPE ON TOP FOR COR. REF. SAME. IN PVMT. 1' WEST OF N/S FENCE ON NORTH SIDE OF RD.
- 1964 ELY #1072 & 1073 IRON STAKE FD. 2668.55 TO S ¼ COR SEC 8, 2653.0X TO E ¼ COR SEC 8, ANGLE 89-36 @ SE COR SEC 8 FROM S ¼ COR SEC 8 TO E ¼ COR SEC 8
- 1966 BATTERMAN VOL 4 PG 279 REF COR. BUT STATES NOTHING ABOUT IT
- 1972 LEE VOL 4 PG 553 DUG & FD 2" GAPPED PIPE 4" DEEP. REF. SAME.
- 1978 SANDSNES VOL 5 PG 447 299,537.88; 2,243,772.32
- 1978 SANDSNES #1104 & 1084 EDGERTON AIR PHOTO CONTROL
- 1980 BARNES VOL 6 PG 42 299,537.88; 2,243,772.32 SANDSNES N88-43-37E 2680.02 TO S ¼ COR SEC 9, SANDSNES S88-38-41W 2668.16 TO S ¼ COR SEC 8, SO-02-57E 2656.47 TO E ¼ COR SEC 17, ANGLE @ NE COR SEC 17 FROM E ¼ COR SEC 17 TO N ¼ COR SEC 17 IS 89-18-46
- 1980 BARNES VOL 6 PG 44 REPLACED GAPPED IRON PIPE. SET ALUM. MON ON TOP OF STONE
- 1981 BARNES VOL 6 PG 201 FD ALUM. MON.
- 1981 AERO-METRIC PHOTO CONTROL NGVD 29 ELEVATION 873.16'
- 1982 BARNES VOL 6 PG 241 FD ALUM. MON. TIED INTO AERO-METRIC PHOTO CONTROL. 299,537.80; 2,243,772.05
- 1983 BARNES VOL 6 PG 303 299,537.88; 2,243,772.32 N1-45-07W 2652.63 TO E ¼ COR SEC 8, S88-38-39W 2668.24 TO S ¼ COR SEC 8
- 1992 SCHROEDER GSM VOL 16 PG 34 STATES NOTHING ABOUT MON.
- 1999 COMBS #7401 ALUM. MON. N89-10-15E 2680.37 TO S ¼ COR SEC 9

FD ALUM. MON. & REFERENCE MONUMENTS.

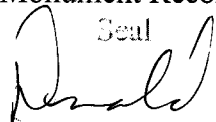
C) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

ACCEPTED FD ALUM. MON.

D) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (a), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 4 of the witness monuments shown on the drawing in (a), above.

NONE

I, **Donald Barnes**, hereby certify that the corner location as identified by the corner code index was determined by me under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Seal

Embloss
Barnes
11/04/07

SHEET 2 OF 2

CORNER CODE **J-9**

A.E. 7.08 REQUIREMENT