

U.S. PUBLIC LAND SURVEY MONUMENT RECORD

For Public Land Survey Corners in:

WI ADMINISTRATIVE CODE A-E 7.08 REQUIREMENT

T. 3N., R. 10E

CORNER CODE INDEX

A	1	2	3	4	5	6	7	8	9	10	11	12	13	14	15	16	17	18	19	20	21	22	23	24	25
B																									
C	6																								
D																									
E																									
F																									
G	1																								
H																									
I																									
J																									
K																									
L	18																								
M																									
N																									
O																									
P	19																								
Q																									
R																									
S																									
T	30																								
U																									
V																									
W																									
X	31																								
Y																									
Z																									

MAGNOLIA TWP

ROCK COUNTY WI

IF AVAILABLE
ROCK COUNTY COORDINATES PERFERRED

North _____ Elev. _____

East _____

Hor. Datum _____ Vert. Datum _____

LATITUDE _____ ELLIPS. HT. _____

LONGITUDE _____

GPS (X) _____ TRAVERSE (X) _____

BASED ON THE FOLLOWING CONTROL:

PLACE MONUMENT SYMBOL AT PROPER LOCATION ON ABOVE INDEX

CORNER MONUMENT

WITNESS MONUMENT

(a)

BEARINGS ARE BASED ON:

FIELD BOOK _____ PAGE # _____

SHEET 1 OF 2

SHOW A PLAN VIEW DRAWING DEPICTING THE CORNER MONUMENT AND SURROUNDING PHYSICAL FEATURES, INCLUDING THE EXCAVATION AREA AND DEPTH.

PLANNING & ZONING COMMITTEE ADOPTED THE ABOVE FORM ON 12/2/1982

CORNER CODE T-17(1)

MA598

(B) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

- 1868 LOCKE VOL 1 PG 326 FOUND STAKE IN CENTER OF HIGHWAY & IN LINE OF FENCES E & W. SET BUR OAK STAKE SURROUNDED BY 3 HARDHEAD STONES. 2657.60 TO NW SEC 26 & 2663.76 TO SW 26.
- 1869 LEE VOL 1 PG 353 FD COR. SET BY LOCKE. 2651.88 TO CENTER SEC 27, 5303.76 TO W ¼ SEC 27, 2663.76 VAR 9-00 TO SE SEC 27, & 2673.66 VAR 9-00 TO NE SEC 27. (ON LINE WITH NE & SE COR SEC 27.
- 1927 BATTERMAN VOL 3 PG 164 STATED THAT CORNER WAS GRADED OUT.
- 1974 LEE CSM VOL 4 PG 163 DOES NOT STATE ANYTHING ABOUT THE CORNER EXCEPT HE SHOWS DISTANCE AND LINE TO IT.
- 1988 BARNES T-17 FOUND LEE'S CSM PIPES. THEY ARE ON LINE WITH THE NORTHEAST AND SOUTHEAST CORNERS OF SECTION 27 & HIS DISTANCE FROM THE NORTHEAST TO THE EAST QUARTER CORNER IS THE PRORATED DISTANCE WITH LEE'S 1869 DISTANCE. I DID NOT HOLD TO LOCKE AND LEE'S (1866) CALL TO THE CENTER OF THE ROAD BECAUSE OF THE EXTREMELY LARGE ROAD CUT. 472.26' NORTH OF THE CORNER THE CSM SHOWS THAT THE SECTION LINE IS 4.5' EAST OF THE CENTER OF THE PVMT. THE CORNER IS 7.5 EAST OF THE CENTER LINE OF THE PVMT. N2-03-27W 2671.92 TO NE COR SEC 27 & S2-03-27E 2661.92 TO SE COR SEC 27. COR IS 2 WEST OF EAST PVMT EDGE.

FD PK 6.3' WEST OF EAST PVMT EDGE & 5.5 EAST OF CENTER OF PVMT. PK IS IN HARMONY WITH REFERENCE MONUMENTS. PAVEMENT WILL BE GROUND OUT.

C) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

ACCEPTED FOUND PK.

D) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (a), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 4 of the witness monuments shown on the drawing in (a), above.

(E) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning the corner location.

I, Donald Barnes, hereby certify that the corner location as identified by the corner code index was determined by me under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.


Seal
Donald Barnes
May 15, 2000

Emboss

Number of included sheets 1

CORNER CODE **T-17(1)**

A-E 7.08 REQUIREMENT

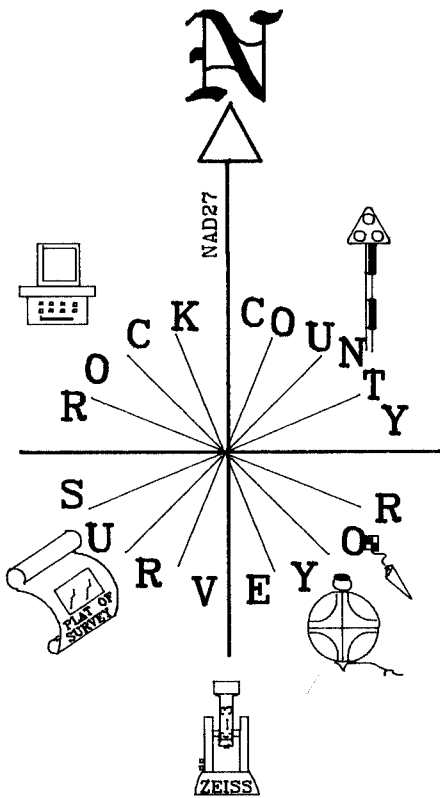

OBSERVATION SHEET
ROAD SURFACE WILL BE DESTROYED.

